

# Inspection Report

**Prepared For:**  
Joan Bridgett

**Property Address:**  
388 Rasberry Lane  
Asheville, NC



## HomeBuyers Inspection HBI

**Russell Buchanan #306  
18 Business Park Circle  
Arden, NC 28704  
877-274-4299**

<b>Date:</b> 9/4/2006	<b>Time:</b> 3:40 PM	<b>Report ID:</b> Sample one
<b>Property:</b> 388 Rasberry Lane Asheville, NC	<b>Customer:</b> Joan Bridgett	<b>Real Estate Professional:</b>

### **Comment Key or Definitions**

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

**Inspected (IN)** = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

**Not Inspected (NI)** = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

**Not Present (NP)** = This item, component or unit is not in this home or building.

**Repair or Replace (RR)** = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

**Age Of Home:**  
Over 50 Years

**Client Is Present:**  
No

**Radon Test:**  
No

**Water Test:**  
No

**Weather:**  
Clear

**Temperature:**  
Over 65

**Rain in last 3 days:**  
No

# 1. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.


		IN	NI	NP	RR	Styles & Materials
1.0	ROOF COVERINGS	X				<b>Roof Covering:</b> 3-Tab fiberglass Tile Rubber membrane
1.1	FLASHINGS	X				
1.2	SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS				X	<b>Viewed roof covering from:</b> Ground
1.3	ROOF DRAINAGE SYSTEMS	X				<b>Sky Light(s):</b> None
		IN	NI	NP	RR	<b>Chimney (exterior):</b> Brick

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

## Comments:



1.2 The brick chimney has loose mortar and missing bricks. Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.

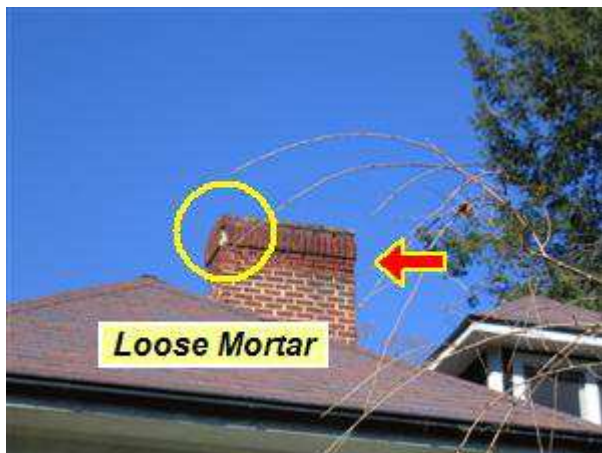

1.2 Picture 1

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 2. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

		IN	NI	NP	RR	
						<b>Styles &amp; Materials</b>
						<b>Siding Style:</b>
						Lap
						Cement stucco
						<b>Siding Material:</b>
						Wood
						Masonry
						<b>Exterior Entry Doors:</b>
						Wood
						<b>Appurtenance:</b>
						Covered porch
						Patio
						<b>Driveway:</b>
						Concrete

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:



2.0 The Brick siding at the left side (facing front) is loose, and missing mortar. Further deterioration can occur if not corrected. A qualified contractor should inspect and repair as needed.



2.0 Picture 1



2.1 The main entry door at rear of home is deteriorated at bottom of jamb (s). Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.





2.1 Picture 1 Rear entry door



2.4 (1) The concrete drive at the front of home is deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Picture 1



(2) The rock steps at the front of home and rear of home are loose in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.



2.4 Picture 2 Front Steps



2.4 Picture 3 Rear steps



(3) The slate floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Picture 4



2.5 The soffit panel at eave on the front of home weathered and beginning to deteriorate. Further deterioration may occur if not repaired.

A qualified contractor should inspect and repair as needed.



2.5 Picture 1

---

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

### 3. Garage

		IN	NI	NP	RR
3.0	GARAGE CEILINGS	X			
3.1	GARAGE WALLS (INCLUDING FIREWALL SEPARATION)	X			
3.2	GARAGE FLOOR	X			
3.3	GARAGE DOOR (S)	X			
3.4	OCCUPANT DOOR FROM GARAGE TO INSIDE HOME	X			
3.5	GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)	X			

#### Styles & Materials

##### Garage Door Type:

One automatic

##### Garage Door Material:

Wood

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

#### Comments:

3.5 The garage door will reverse when met with resistance.

## 4. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Living Room



Kitchen



Bedroom

		IN	NI	NP	RR
4.0	CEILINGS				X
4.1	WALLS	X			
4.2	FLOORS	X			
4.3	STEPS, STAIRWAYS, BALCONIES AND RAILINGS				X
4.4	COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS	X			
4.5	DOORS (REPRESENTATIVE NUMBER)	X			
4.6	WINDOWS (REPRESENTATIVE NUMBER)	X			

IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Styles & Materials

#### Ceiling Materials:

Drywall  
Plaster

#### Wall Material:

Drywall  
Plaster

#### Floor Covering(s):

Hardwood T&G  
Tile  
Vinyl  
Wood

#### Interior Doors:

Raised panel

#### Window Types:

Casement  
Single pane

#### Cabinetry:

Wood  
Veneer

#### Countertop:

Tile

Comments:





4.0 The Ceiling Tile on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.



4.0 Picture 1 DR Ceiling



4.3 The hand/guard rail for the stairs to basement are missing balusters. Spacing more than 4 inches apart could allow an adult, child or pet to fall through. Treads are not supported properly. A qualified contractor should repair or replace as needed.



4.3 Picture 1 basement stairs

---

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 5. Structural Components


The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

		IN	NI	NP	RR	Styles & Materials
5.0	FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	X				<b>Foundation:</b> Brick Masonry block  <b>Method used to observe Crawlspace:</b> From entry Limited access Obstructed  <b>Floor Structure:</b> 2 X 8 2 X 10 Wood joists  <b>Wall Structure:</b> Wood Masonry
5.1	WALLS (Structural)	X				<b>Columns or Piers:</b> Brick piers Masonry block Supporting walls  <b>Ceiling Structure:</b> 2X6  <b>Roof Structure:</b> Stick-built 2 X 6 Rafters Common board  <b>Roof-Type:</b> Gable Hip  <b>Method used to observe attic:</b> From entry  <b>Attic info:</b> Attic access Storage
5.2	COLUMNS OR PIERS	X				
5.3	FLOORS (Structural)				X	
5.4	CEILINGS (structural)	X				
5.5	ROOF STRUCTURE AND ATTIC	X				

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:

5.0 There is a large snake in crawlspace. Recommend feeding it regularly.

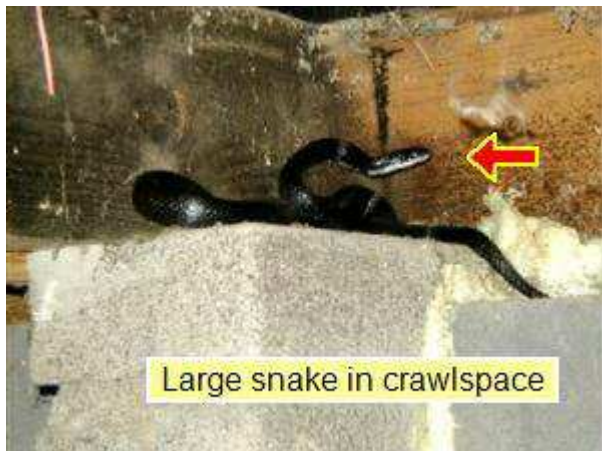

5.0 Picture 1 Black snake



5.3 Signs of fungi growth is present on the floor system in crawlspace in several areas. We did not inspect, test or determine if this growth is or

is not a health hazard. The underlying cause is moisture. I recommend you contact a mold inspector or expert for investigation or correction if needed.



5.3 Picture 1

---

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 6. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

		IN	NI	NP	RR	Styles & Materials
6.0	PLUMBING DRAIN, WASTE AND VENT SYSTEMS				X	<b>Water Source:</b> Public
6.1	PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES				X	<b>Plumbing Water Supply (into home):</b> PVC
6.2	HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS	X				<b>Plumbing Water Distribution (inside home):</b> POLY
6.3	MAIN WATER SHUT-OFF DEVICE (Describe location)	X				<b>Washer Drain Size:</b> 2" Diameter
6.4	FUEL STORAGE AND DISTRIBUTION SYSTEMS (Interior fuel storage, piping, venting, supports, leaks)	X				<b>Plumbing Waste:</b> PVC
6.5	MAIN FUEL SHUT OFF (Describe Location)	X				Cast iron
6.6	SUMP PUMP			X		<b>Water Heater Power Source:</b> Gas (quick recovery)
		IN	NI	NP	RR	<b>Water Heater Capacity:</b> 40 Gallon (1-2 people)
						<b>Manufacturer:</b> A.O. SMITH

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:




**6.0** The waste line has a S-trap, and should be changed to a P-trap and "Auto-vent" at the Kitchen sink. This is not considered up to today's standard. A qualified licensed plumber should repair or correct as needed.



6.0 Picture 1 Under Kitchen sink




**6.1 (1)** The outside water faucets are loose, and needs securing to wall , leaks when turned on and leaks at vacuum breaker at the right side (facing front) and left side (facing front). Repairs are needed. A qualified licensed plumber should repair or correct as needed.

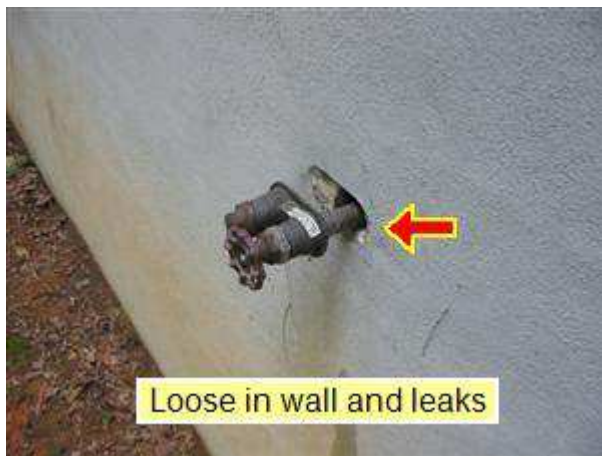


6.1 Picture 1 Right side facing front



6.1 Picture 2 Left side facing front


 (2) Polybutylene plastic plumbing supply lines (PB) are installed in the subject house. Polybutylene has been used in this area for many years, but has had a higher than normal failure rate, and is no longer being widely used. Copper and Brass fittings used in later years have apparently reduced the failure rate. This subject house has copper fittings. For further details contact the Consumer Plumbing Recovery center at 1-800-392-7591 or the web at <http://www.pbpipeline.com>

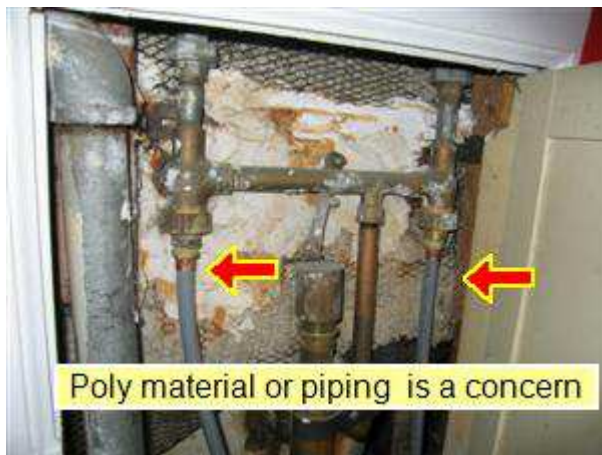

6.1 Picture 3 Hall bath closet access



6.1 Picture 4 Master bath closet access

 (3) The toilet supply valve for toilet is leaking at the hall bath. Repairs are needed. A qualified person should repair as necessary.



6.1 Picture 5 Hall toilet

6.3 The main shut off is the knob located in the basement on the front wall. This is for your information.

6.5 The main fuel shut off is at gas meter outside for water heater. The main shut off for oil is at oil barrel outside for boiler.

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern,



some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 7. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

		IN	NI	NP	RR	Styles & Materials
7.0	SERVICE ENTRANCE CONDUCTORS	X				<b>Electrical Service Conductors:</b> Overhead service Aluminum 220 volts
7.1	SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS	X				<b>Panel capacity:</b> 200 AMP
7.2	BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE	X				<b>Panel Type:</b> Circuit breakers
7.3	CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)				X	<b>Electric Panel Manufacturer:</b> FEDERAL PACIFIC
7.4	POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE	X				<b>Branch wire 15 and 20 AMP:</b> Copper
7.5	OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)	X				<b>Wiring Methods:</b> Romex Knob and Tube Not Visible
7.6	LOCATION OF MAIN AND DISTRIBUTION PANELS	X				
7.7	SMOKE DETECTORS	X				
7.8	CARBON MONOXIDE DETECTORS			X		
		IN	NI	NP	RR	

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:



**7.2** You have a Federal Pacific panel which is legal, but there is a possibility that the circuit breakers may not trip when shorted possibly causing an electrical hazard. Opinions by licensed electricians on this panel varies between safe and unsafe. I recommend you consult a licensed electrician for an opinion and correct if necessary.



7.2 Picture 1 Federal Panel in basement



**7.3** One loose wire splice and One loose wire end need placing in boxes with cover-plates within "Five feet" of attic access and above the Guest bath in attic. This is a safety issue that needs to be corrected. I recommend a qualified licensed electrician correct.



7.3 Picture 1 near attic access



7.3 Picture 2 attic view

#### 7.6 The main panel box is located at the basement.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 8. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

		IN	NI	NP	RR	
8.0	HEATING EQUIPMENT	X				<b>Styles &amp; Materials</b> <b>Heat Type:</b> Circulating boiler
8.1	NORMAL OPERATING CONTROLS	X				<b>Energy Source:</b> Oil
8.2	AUTOMATIC SAFETY CONTROLS	X				<b>Number of Heat Systems (excluding wood)</b> One
8.3	DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	X				<b>Types of Fireplaces:</b> Vented gas logs
8.4	PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM	X				<b>Operable Fireplaces:</b> One
8.5	CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)				X	<b>Number of Woodstoves:</b> None
8.6	SOLID FUEL HEATING DEVICES (Fireplaces, Woodstove)			X		<b>Number of AC Only Units:</b> None
8.7	GAS/LP FIRELOGS AND FIREPLACES	X				
8.8	COOLING AND AIR HANDLER EQUIPMENT			X		


IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:



**8.5** The vent pipe for oil fired boiler needs mastic sealed around pipe where it enters chimney. Possible asbestos sleeving on vent pipe. This is a safety issue and should be repaired. I recommend a qualified licensed heat contractor inspect further and repair as needed.

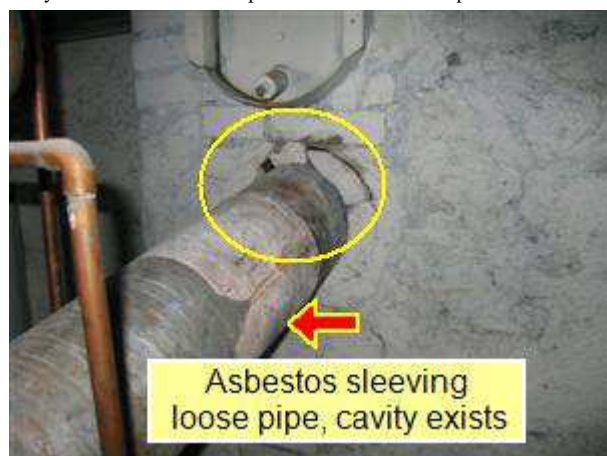

8.5 Picture 1 vent pipe at basement



**8.8** There is no central air conditioning in this home. This home has no central air (No AC). This is for your information.

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 9. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

		IN	NI	NP	RR	Styles & Materials
9.0	INSULATION IN ATTIC	X				<b>Attic Insulation:</b> Fiberglass R-19
9.1	INSULATION UNDER FLOOR SYSTEM	X				<b>Ventilation:</b> Passive
9.2	VAPOR RETARDERS (ON GROUND IN CRAWLSPACE OR BASEMENT)	X				<b>Exhaust Fans:</b> Fan
9.3	VENTILATION OF ATTIC AND FOUNDATION AREAS	X				<b>Dryer Power Source:</b> 220 Electric
9.4	VENTING SYSTEMS (Kitchens, baths and laundry)				X	<b>Dryer Vent:</b> PVC Rigid
9.5	VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)			X		<b>Floor System Insulation:</b> Unfaced Below R-19
		IN	NI	NP	RR	

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

### Comments:



9.4 The Exhaust fan does not vent to outside at the guest bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. A qualified contractor should inspect and repair as needed.



9.4 Picture 1 Exhaust from bath fan

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



## 10. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

		IN	NI	NP	RR	Styles & Materials
10.0	DISHWASHER	X				<b>Dishwasher Brand:</b> GENERAL ELECTRIC
10.1	RANGES/OVENS/COOKTOPS	X				<b>Disposer Brand:</b> IN SINK ERATOR
10.2	RANGE HOOD	X				<b>Exhaust/Range hood:</b> BROAN
10.3	TRASH COMPACTOR			X		<b>Range/Oven:</b> MAGIC CHEF
10.4	FOOD WASTE DISPOSER	X				<b>Built in Microwave:</b> KENMORE
10.5	MICROWAVE COOKING EQUIPMENT	X				
		IN	NI	NP	RR	

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Prepared Using HomeGauge <http://www.homegauge.com> SHGI (c) 2000-2004 : Licensed To Complete Building Inspections

# General Summary



**HomeBuyers Inspection HBI**

**18 Business Park Circle  
Arden, NC 28704  
877-274-4299**

**Customer**  
Joan Bridgett

**Property Address**  
388 Rasberry Lane  
Asheville, NC

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 1. Roofing

### 1.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

#### Repair or Replace



The brick chimney has loose mortar and missing bricks. Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.

## 2. Exterior

### 2.0 WALL CLADDING FLASHING AND TRIM

#### Repair or Replace



The Brick siding at the left side (facing front) is loose, and missing mortar. Further deterioration can occur if not corrected. A qualified contractor should inspect and repair as needed.

### 2.1 DOORS (Exterior)

#### Repair or Replace



The main entry door at rear of home is deteriorated at bottom of jamb (s). Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.

### 2.4 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

#### Repair or Replace



(1) The concrete drive at the front of home is deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.



(2) The rock steps at the front of home and rear of home are loose in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.



(3) The slate floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.

### 2.5 EAVES, SOFFITS AND FASCIAS

#### Repair or Replace

The soffit panel at eave on the front of home weathered and beginning to deteriorate. Further deterioration may occur

- ☒ if not repaired. A qualified contractor should inspect and repair as needed.

## 4. Interiors

### 4.0 CEILINGS

#### Repair or Replace

- ☒ The Ceiling Tile on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.

### 4.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS


#### Repair or Replace

- ☒ The hand/guard rail for the stairs to basement are missing balusters. Spacing more than 4 inches apart could allow an adult, child or pet to fall through. Treads are not supported properly. A qualified contractor should repair or replace as needed.

## 5. Structural Components

### 5.3 FLOORS (Structural)

#### Repair or Replace

-  ☒ Signs of fungi growth is present on the floor system in crawlspace in several areas. We did not inspect, test or determine if this growth is or is not a health hazard. The underlying cause is moisture. I recommend you contact a mold inspector or expert for investigation or correction if needed.

## 9. Insulation and Ventilation

### 9.4 VENTING SYSTEMS (Kitchens, baths and laundry)

#### Repair or Replace

- ☒ The Exhaust fan does not vent to outside at the guest bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. A qualified contractor should inspect and repair as needed.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

# Electrical Summary



**HomeBuyers Inspection HBI**

**18 Business Park Circle  
Arden, NC 28704  
877-274-4299**

**Customer**  
Joan Bridgett

**Property Address**  
388 Rasberry Lane  
Asheville, NC

The following **Electrical** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 7. Electrical System

### 7.2 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE

#### Inspected



You have a Federal Pacific panel which is legal, but there is a possibility that the circuit breakers may not trip when shorted possibly causing an electrical hazard. Opinions by licensed electricians on this panel varies between safe and unsafe. I recommend you consult a licensed electrician for an opinion and correct if necessary.

### 7.3 CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)

#### Repair or Replace



One loose wire splice and One loose wire end need placing in boxes with cover-plates within "Five feet" of attic access and above the Guest bath in attic. This is a safety issue that needs to be corrected. I recommend a qualified licensed electrician correct.

# Plumbing Summary



**HomeBuyers Inspection HBI**

**18 Business Park Circle  
Arden, NC 28704  
877-274-4299**

**Customer**  
Joan Bridgett

**Property Address**  
388 Rasberry Lane  
Asheville, NC

The following **Plumbing** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 6. Plumbing System

### 6.0 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

#### Repair or Replace



The waste line has a S-trap, and should be changed to a P-trap and "Auto-vent" at the Kitchen sink. This is not considered up to today's standard. A qualified licensed plumber should repair or correct as needed.

### 6.1 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

#### Repair or Replace



(1) The outside water faucets are loose, and needs securing to wall , leaks when turned on and leaks at vacuum breaker at the right side (facing front) and left side (facing front). Repairs are needed. A qualified licensed plumber should repair or correct as needed.



(2) Polybutylene plastic plumbing supply lines (PB) are installed in the subject house. Polybutylene has been used in this area for many years, but has had a higher than normal failure rate, and is no longer being widely used. Copper and Brass fittings used in later years have apparently reduced the failure rate. This subject house has copper fittings. For further details contact the Consumer Plumbing Recovery center at 1-800-392-7591 or the web at <http://www.pbpipe.com>



(3) The toilet supply valve for toilet is leaking at the hall bath. Repairs are needed. A qualified person should repair as necessary.



# Structural Summary



HomeBuyers Inspection HBI

18 Business Park Circle  
Arden, NC 28704  
877-274-4299

Customer  
Joan Bridgett

Property Address  
388 Rasberry Lane  
Asheville, NC

The following **Structural** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 5. Structural Components

### 5.3 FLOORS (Structural)

#### Repair or Replace



Signs of fungi growth is present on the floor system in crawlspace in several areas. We did not inspect, test or determine if this growth is or is not a health hazard. The underlying cause is moisture. I recommend you contact a mold inspector or expert for investigation or correction if needed.

---

Prepared Using HomeGauge <http://www.homegauge.com> SHGI (c) 2000-2004 : Licensed To Complete Building Inspections

# Heating Cooling / Summary



**HomeBuyers Inspection HBI**

**18 Business Park Circle  
Arden, NC 28704  
877-274-4299**

**Customer**  
Joan Bridgett

**Property Address**  
388 Rasberry Lane  
Asheville, NC

The following **Heating and Cooling** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 8. Heating / Central Air Conditioning

### 8.5 CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)

#### Repair or Replace



The vent pipe for oil fired boiler needs mastic sealed around pipe where it enters chimney. Possible asbestos sleeving on vent pipe. This is a safety issue and should be repaired. I recommend a qualified licensed heat contractor inspect further and repair as needed.

### 8.8 COOLING AND AIR HANDLER EQUIPMENT

#### Not Present



There is no central air conditioning in this home. This home has no central air (No AC). This is for your information.

---

Prepared Using HomeGauge <http://www.homegauge.com> SHGI (c) 2000-2004 : Licensed To Complete Building Inspections



# INVOICE

**HomeBuyers Inspection HBI**  
**18 Business Park Circle**  
**Arden, NC 28704**  
**877-274-4299**  
**Inspected By: Russell Buchanan #306**

**Inspection Date: 9/4/2006**  
**Report ID: Sample one**

Customer Info:	Inspection Property:
Joan Bridgett  <b>Customer's Real Estate Professional:</b>	388 Rasberry Lane Asheville, NC

## Inspection Fee:

Service	Price	Amount	Sub-Total
Heated Sq Ft 4,001 - 4,500	450.00	1	450.00
			<b>Tax \$0.00</b>
			<b>Total Price \$450.00</b>

**Payment Method:** Credit Card  
**Payment Status:** Paid  
**Note:**